


# Warning, Maintenance and Technical Alert

**The Issue:** As a result of wear over some years a major user of RegO A7575L4 Safety Hose Filler Couplings has found one instance where the retaining collar on the tailpiece of this coupling has worn away to the extent where the tailpiece has been allowed to travel through the handle assembly.

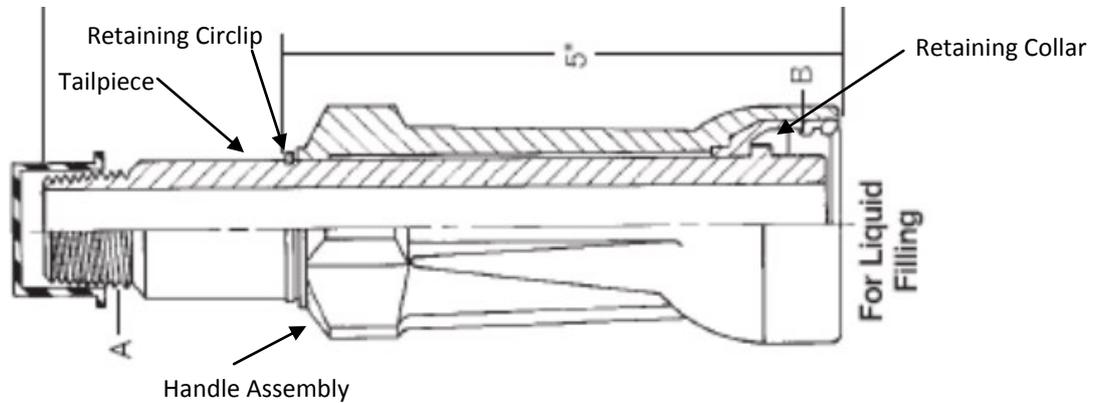

**Warning:** If the unit separates under pressure, that is during a filling operation, there is the potential for product discharge and operator injury.

**What to do and what you might find:** Inspect by removing the retaining circlip from the tailpiece and slide the handle assembly back to reveal the collar. See examples below:



**How much wear is safe:** This issue has come to light over the last 72 hours and RegO has yet to consider and respond to the detail revealed. As soon as RegO has responded a further notice will be issued. It will be posted under 'News' at [gameco.com.au](http://gameco.com.au) and is expected early next week.

**We remind you of the following general warning:**

## **Warning**

All REGO® products are mechanical devices that will eventually become inoperative due to wear, corrosion and aging of components made of materials such as rubber. The environment and conditions of use will determine the safe service life of these products. Periodic inspection and maintenance are essential to avoid serious injury and property damage.

Many REGO® products are manufactured for storage, transport, transfer and use of toxic flammable and dangerous liquids and gases. Such substances should be handled by experienced and trained personnel only, using accepted governmental and industrial safety procedures. Never vent LP-Gas near any possible source of ignition.



Gameco (NSW) Pty Ltd

ABN: 93 001 367 862

Sydney: (02) 9648 5856

Melbourne: (03) 9480 3633

Brisbane: (07) 3377 7999

Web: [gameco.com.au](http://gameco.com.au)